

BRACKETT

Aircraft
Co., Inc.

7045 FLIGHTLINE DR.
KINGMAN, AZ 86401
520-757-4005, FAX 520-757-1948

BRACKETT AIR FILTERS

SERVICE BULLETIN #5 7-28-80

SUBJECT: Loose gaskets

FILTER MODELS: BA-100, BA-2310, BA-5710, BA-6210, BA-7110, BA-7210,
BA-7310, BA-7410, BA-7510 that were manufactured prior to July 1980.

REASON: Product Improvement. Gaskets have become loose due to oils,
grease, fuel, loose and poorly fit fasteners that hold the filter
in place. This has been a problem area for years with all brands
of filters that use this type gasket.

CHANGE: Brackett Aircraft Co. Inc. is installing gasket retainer strips
that will prevent a gasket from entering the induction system in
event the gasket should become loose. This is effective on all
above models manufactured after June 1980 and on.

RETROFIT: Brackett Aircraft Co. Inc. is making available kits to upgrade
existing filter.

COMPLIANCE: Owner's discretion.

ESTIMATED MAN HOURS: Approximately 1 hour.

APPROVAL: FAA-WE

MATERIAL:	<u>FOR FILTER ASSY.</u>	<u>ORDER KIT NO.</u>
	BA-100	BA-10A
	BA-2310	BA-23A
	BA-5710	BA-57A
	BA-6210	BA-62A
	BA-7110	BA-71A
	BA-7210	BA-71A-72
	BA-7310	BA-73A
	BA-7410	BA-71A-74
	BA-7510	BA-62A-75

KIT PRICE - \$5.00 all kits